FMEA FMEA	HAME, GTY, & DRAWING REF.	FAILURE HODE AND	FAILURE EFFECT	HDWR / FUNC.	RATIONALE FOR ACCEPTANCE
	DESIGNATION	CAUSE	END TIEM	CRITICALITY	SCREENS: N/A
1071 1	OUTPUT MULTIPLEXER GIY-1 SCHEMATIC ED 87305	HODE: DATA ERRATIC FRON DAC TO MCIU.  CAUSE(S): (1) FAILURE OF THE INVERTER NETWORK. (2) FAILURE OF THE SELECTOR CIRCUIT. (3) FAILURE OF PARALLEL/ SERIAL CONVERTER.	DATA ERRATIC FROM DBC TO MCIU. EFFECTS VARY DEPENDING UPON WHICH WORD/BIT FAILS. IF IN EE AUTO MODE, POSSIBLE PREMATURE RELEASE. COULO DROP IN OR OUT OF WATE HOLD. MAY MOT BE ABLE TO STOP AUTO SEQUENCE WITH STOP SWITCH. MAY NOT LIMP IN E/E MANUAL MODE. MAY MOT BE ABLE TO CANCEL MCIU SAFIMG. GPC MAY DROP INTO TOLE.  EE COMMAND MAY FAIL ON. EE MAY BE COMMANDED AS SOOM AS EE MOD SWITCH SET TO AUTO. OR POSSIBLE LOSS OF EE MOTO COMMANDED AS SOOT AS TO COMMANDED AS WITCH SET TO AUTO. OR POSSIBLE LOSS OF EE MOTO COMMANDED AS SOOT AS EE MOTO COMMANDED AS WITCH SET TO AUTO. OR POSSIBLE LOSS OF EE MOTO COMMANDED AND LOSS OF LIMPING DURING CAPTURE.  WORST CASE UNEXPECTED MOTION. 6 JOINT RUNGWANNUMCTATED. CREW ACTION REQUIRED.  REDUNDANT PATHS REMAINING M/A	GATES. THESE AND CHOS DEVICES OF SIGHTFICANT OPPOSED TO SIGHTFICATION OF SIGHTFICATION OPPOSED TO SIGHTFIC	EKING IS PERFORMED BY THREE, QUAD AND/OR SELECT RE 'A' TYPE CMOS DEVICES, GÉNERIC TYPE 4019.  PERATE AT LOW POWER AND HENCE DO NOT EXPERIENCE ERATING STRESSES. THE TECHNOLOGY IS MATURE, AND LITY HISTORY IS WELL DOCUMENTED. ALL STRESSES LY REDUCED BY DERATING THE APPROPRIATE ACCORDANCE WITH SPAR-RMS-PA.OOS. SPECIAL UTIONS ARE USED AT ALL STAGES OF MANUFACTURE TO E/STRESS DUE TO ELECTROSTATIC DISCHARGE.  BEEN SELECTED AND CONTROLLED IN ACCORDANCE WITH 3. THIS DOCUMENT DEFINES THE PROGRAM OR MONITORING AND CONTROLLING EEE PARTS. THE NCLUDE PARTS SELECTION TO AT LEAST "ESTABLISHED EVELS, AND ADEQUATE DERATING OF PART STRESS UNES AND ADEQUATE DERATING OF PART STRESS ALYSIS HAS CONFIRMED NO PARTS WITH GENERICALLY AS BEEN REVIEWED AND FOUND SATISFACTORY THROUGH IT PROCESS, INCLUDING THE USE OF RELIABILITY, TO SPAR-SG.368 WHICH IS EQUIVALENT TO THE MASA E REQUIREMENTS. WORST CASE ANALYSIS HAS BEEN MISURE THAT PERFORMANCE CAN BE NET UNDER WORST RE AND AGING EFFECTS. EEE PARTS STRESS ANALYSIS ETED AND CONFIRMS THAT THE PARTS MEET THE REMENTS.  IT BOARD DESIGNS HAVE BEEN REVIEWED TO EMSURE ITT PATH WIDTH AND SEPARATION AND TO COMPONENT S.  METHODS ARE CONTROLLED IN ACCORDANCE WITH NO CAE POD3489. THESE DOCUMENTS REQUIRE ING METHODS, STRESS RELIEF, AND COMPONENT  LE, DESIGN DRAWINGS AND DOCUMENTATION GIVE CLEAR OF HANDLING PRECAUTIONS FOR ESD SENSITIVE  DRAWINGS INCLUDE THE REQUIREMENT FOR SOLDERING ICCORDANCE WITH NHB 5300.4(3A) AND JSC D8800A.

## CRITICAL ITEMS LIST

FMEA REF.	FMEA REV.	HAME, GTY, B DRAWING REF. DESIGNATION	FAILURE MODE AND CAUSE	FAILURE EFFECT ON END ITEM	HOUR / FUNC. 1/1 CRITICALITY	RATIONALE FOR ACCEPTANCE SCREENS: N/A
1071		OUTPUT MULTIPLEXER 917-1 SCHEMATIC ED 87305	MODE: DATA ERRATIC FROM DAC TO MCIU.  CAUSE(S): (1) FAILURE OF THE INVENTER METWORK.  (2) FAILURE OF THE SELECTOR GIRCUIT.  (3) FAILURE OF PARALLEL/ SERIAL CONVERTER.	DATA ERRATIC FROM DEC TO SCIU. EFFECTS VARY DEPENDING UPON WHICH WORD/BIT FAILS. IF IN EE AUTO HODE, POSSIBLE PREMATURE RELEASE. COULD DROP IN OR OUT OF RATE HOLD. MAY NOT BE ABLE TO STOP AUTO SEQUENCE WITH STOP SWITCH. MAY NOT LIMP IN E/E MANUAL MODE. MAY MOT BE ABLE TO CANCEL MCIU SAFING. GPC MAY DROP INTO IDLE. EE COMMAND MAY FAIL ON. EE MAY BE COMMANDED AS SOON AS EE MCOE SMITCH SET TO AUTO. OR POSSIBLE LOSS OF EE AUTO COMMANDED AND LOSS OF LIMPING DURING CAPTURE. WORST CASE UNEXPECTED MOTION. 6 JOINT RUNAMAY. UNCOMMANDED END EFFECTOR RUNAMAY. UNCOMMANDED END EFFECTOR REQUIRED. REDUNDANT PATHS REMAINING	ENVIRONMENTAL TES  O VIBRATION: LE  O THERMAL: +1  THE D2C PANEL ASS SYSTEM (TP516 RM WHICH VERIFIES TH  GUALIFICATION TES  THE D2C PANEL HAS GUALIFICATION: LE  O SHOCK: 2C  O THERMAL: 13  PE  O HUMIDITY: 95  O EMC: MI  CE  RE	M IS SUBJECTED TO THE FOLLOWING ACCEPTANCE STING AS PART OF THE DEC PANEL.  EVEL AND DURATION - REFERENCE TABLE 1  100 DEGREES F TO +10 DEGREES F 2 CYCLES  P.5 HRS PER CYCLE)  SEMBLY IS FURTHER TESTED AS PART OF THE RMS S STRONGBACK TEST AND TP552 FLAT FLOOR TEST) HE ABSENCE OF THE FAILURE MODE.  STS S BEEN SUBJECTED TO THE FOLLOWING

PREPARED BY:

MFWG

SUPERCEDING DATE: 06 OCT 87

PREPARED BY:

FMEA Ref.	FMEA REV.	HAME, GTY, & DRAWING REF.	FAILURE MODE AND	FAILURE EFFECT	HDUR / FUNC. RATIONALE FOR ACCEPTANCE
FMEA REF.		HAME, GTY, & ORAVING REF. DESIGNATION  OUTPUT MULTIPLEXER GTY-1 SCHEMATIC ED 87305			
			(3) FAILURE OF PARALLEL/ SERIAL CONVERTER.	MAY NOT LIMP IN E/E MANUAL MODE. MAY NOT BE ABLE TO CAMCEL MCITY SAFING. GPC MAY DROP INTO IDLE. EE COMMAND MAY FAIL ON. EE MAY BE COMMANDED AS SOON AS EE MODE SWITCH SET TO AUTO. OR POSSIBLE LOSS OF EE AUTO COMMANDS AND LOSS OF LIMPING DURING CAPTURE. WORST CASE UMEXPECTED MOTION. 6 JOINT RUNAWAY. UNCOMMANDED END EFFECTOR RELEASE. UMANNUNCIATED. CREW ACTION REQUIRED.  REDUNDANT PATHS REMAINING M/A	RECEIVING INSPECTION VERIFIES THAT ALL PARTS RECEIVED ARE AS IDENTIFIED IN THE PROCURENT DURING SHIPMENT, THAT THE RECEIVING DOCUMENTS PROVIDE ADEQUATE TRACEABILITY INFORMATION AND SCREENING DATA CLEARLY IDENTIFIES ACCEPTABLE PARTS.  PARTS ARE INSPECTED THROUGHOUT MANUFACTURE AND ASSEMBLY AS APPROPRIATE TO THE MANUFACTURING STAGE COMPLETED. THESE INSPECTIONS INCLUDE,  PRINTED CIRCUIT BOARD INSPECTION FOR TRACK SEPARATION, DAMAGE AND ADEQUACY OF PLATED THROUGH HOLES,  COMPONENT MOUNTING INSPECTION FOR CORRECT SOLDERING, WIRE LOOPING, STRAPPING, ETC. OPERATORS AND INSPECTORS ARE TRAINED AND CERTIFIED TO MASA MHB 5300.4(3A) STANDARD, AS MODIFIED BY JSC 08800A.  CONFORMAL COATING INSPECTION FOR ADEQUATE PROCESSING IS PERFORMED USING ULTRAVIOLET LIGHT TECHNIQUES.  POST P.C. BD. INSTALLATION INSPECTION, CLEANLINESS AND WORKMANSHIP (SPAR/GOVERNMENT REP. MANDATORY INSPECTION POINT)  P.C. BD. INSTALLATION INSPECTION, CHECK FOR CORRECT BOARD INSTALLATION, ALIGHMENT OF BOARDS, PROPER CONNECTOR CONTACT MATING, WIRE ROUTING, STRAPPING OF WIRES ETC.,  PRE-TEST INSPECTION OF DAC PAMEL ASSY INCLUDES AN AUDIT OF LOWER TIER INSPECTION COMPLETION, AS BUILD CONFIGURATION VERIFICATION TO AS DESIGN ETC. (SPAR/GOVERNMENT REP. MANDATORY INSPECTION POINT)  A TEST READINESS REVIEW (TRR) WHICH INCLUDES VERIFICATION OF TEST PERSONNEL, TEST DOCUMENTS, TEST EQUIPMENT CALIBRATION/VALIDATION STATUS AND HARDWARE CONFIGURATION IS CONVENED BY OUALITY ASSURANCE IN COMJUNCTION WITH HIGH HEERING, RELIABILITY, CONFIGURATION CONTROL, SUPPLIER AS APPLICABLE, AND THE GOVERNMENT REPRESENTATIVE, PRIOR TO THE START OF ANY FORMAL TESTING (ACCEPTANCE OR QUALIFICATION).
	]				ACCEPTANCE TESTING (ATP) INCLUDES AMBIENT PERFORMANCE,

HFNG

PREPARED BY:

RITICAL ITEMS LIST		PROJECT: SRMS ASS'Y NOMERICLATURE: DEC PANEL			SYSTEM: DEC SUBSYSTEM ASS'Y P/R: 51140E391 SHEET:		
FMEA REF.	FMEA REV.	NAME GTY & DRAWING REF. DESIGNATION	FAILURE MODE AND CAUSE	FAILURE EFFECT ON END 1TEM	f / FUNC. 1/1 CRITICALITY	RATIONALE FOR ACCEPTANCE SCREENS: N/A	
1071		OUTPUT MULTIPLEXER OTY-1 SCHEMATIC ED 87305	MODE: DATA ERRATIC FROM D&C TO MCIU.  CAUSE(\$): (1) FAILURE OF THE INVERTER METWORK. (2) FAILURE OF THE SELECTOR CIRCUIT. (3) FAILURE OF PARALLEL/ SETIAL CONVERTER.	DATA ERRATIC FROM DEC TO MCIU. EFFECTS VARY DEPENDING UPON WHICH WORD/BIT FAILS. IF IN EE AUTO HODE, POSSIBLE PREMATURE RELEASE. COULD DROP IN OR OUT OF RATE HOLD. MAY HOT BE ABLE TO STOP AUTO SEQUENCE WITH STOP SWITCH. MAY HOT LIMP IN E/E MANUAL MODE. MAY HOT BE ABLE TO CANCEL MCIU SAFING. GPC MAY DROP INTO IDLE. EE COMMANDED AS SOON AS EE HODE SWITCH SET TO AUTO. OR POSSIBLE LOSS OF EE AUTO COMMANDED AS SOON AS EE HODE SWITCH SET TO AUTO. OR UTING CAPTURE. WORST CASE UNEXPECTED MOTION. 6 JOINT RUMANAY. UNCOMMANDED END EFFECTOR RELEASE. UNANHUNCIATED. CREW ACTION REGUIRED. REDUNDANT PATHS REMAINING N/A	MANDATORY INS INTEGRATION OF PERFORMED AT GROUNDING CHE INSPECTION FOR SUB-SYSTEM PROFESSIONAL STATEMENT OF THE SUBASSEMBLIES INSPECTIONS INCLUDES GROUNTERFACE CONSTRUCTORS OF THE STATEMENT OF THE SUBASSEMBLIES INSPECTIONS INCLUDES GROUNTERFACE CONSTRUCTIONS OF THE STATEMENT OF	PIBRATION TESTING, (SPAR/GOVERNMENT REP SPECTION POINT).  OF DEC PAMEL, RHC, THC AND MCIU, IMSPECTIONS ARE EACH STAGE OF INTEGRATION, WHICH INCLUDES CKS, INTER CONNECT CABLE VEHIFICATION, CONNECTOR OR BENT OR PUSHBACK CONTACTS ETC.  ERFORMANCE TESTING (ATP), INCLUDES AN AMBIENT MEST. (MANDATORY INSPECTION POINT).  INTEGRATION, THE INTEGRATION OF MECHANICAL ARM IN AND THE FLIGHT CABIN EQUIPMENT TO FORM THE SRMS. ARE PERFORMED AT EACH PHASE OF INTEGRATION WHICH MIDING CHECKS, THRU WIRING CHECKS, WIRING ROUTING, HIESTING - STRONGBACK AND FLAT FLOOR AMBIENT MESTING - STRONGBACK AND FLAT FLOOR AMBIENT MEST. (SPAR/GOVERNMENT REP MANDATORY INSPECTION	

SUPERCEDING DATE: 06 OCT 87

DATE: 24 JUL 91

CIL REV: 1

FHEA	FHEA	HAME, OTY, & DRAVING REF.	FAILURE MODE	FAILURE EFFECT ON	HOWR / FUNC.	RATIONALE FOR ACCEPTANCE
REF.	REV.	DESIGNATION	CAUSE	ENDTITEM	CRETICALITY	SCREENS: N/A
1071		CUTPUT MULTIPLEXER QTY-1 SCHEMATIC ED 87305	MODE: DATA ERRATIC FROM D&C TO MCIU.  CAUSE(\$): (1) FAILURE OF THE INVERTER HETWORK.  (2) FAILURE OF THE SELECTOR CIRCUIT.  (3) FAILURE OF PARALLEL/ SERTAL CONVERTER.	DATA ERRATIC FROM D&C TO MCIU. EFFECTS VARY DEPENDING UPON WHICH WORD/BIT FAILS. IF IN EE AUTO MODE, POSSIBLE PREMATURE RELEASE. COULD DROP IN OR OUT OF RATE HOLD. MAY NOT BE ABLE TO STOP AUTO SEQUENCE WITH STOP SWITCH. MAY NOT LIMP IN E/E MANUAL MODE. MAY NOT BE ABLE TO CANCEL MCIU SAFING. GPC MAY DROP INTO IDLE.  EE COMMANDED AS SOON AS EE MODE SWITCH SET TO AUTO. OR POSSIBLE LOSS OF EE AUTO COMMANDED AS SOON AS EE MODE SWITCH SET TO AUTO. OR POSSIBLE LOSS OF EE AUTO COMMANDED AND LOSS OF LIMPING DURING CAPTURE. WORST CASE UNEXPECTED MOTION, 6 JOINT RUHAWAY. UNCOMMANDED END EFFECTOR RELEASE. UNANNUNCIATED. CREW ACTION REQUIRED. REDUNDANT PATHS REMAINING	FAILURE HIS NO EEE PARTS PARTS.	S FAILURES HAVE OCCURRED SUBSEQUENT TO ASSEMBLY OF
PREPARED 1	BY:	1FWG	SUPERCEDING DAT	E: 06 OCT 87	APPROVED BY:	DATE: 24 JUL 91 CIL REV:

RMS/D&C - 200

PROJECT: SRMS ASS'Y NOMENCLATURE: DEC PANEL SYSTEM: D&C SUBSYSTEM ASS'Y P/N: 51140E391\_

SHEET:

FMEA NEF.	FMEA REV.	NAME, Q1Y, & DRAWING REF. DESIGNATION	FAILURE MODE AND CAUSE	FAILURE EFFECT ON END ITEM	HDVR / FUNC. AATIONALE FOR ACCEPTANCE 1/1 CRITICALITY SCREENS: N/A
1071		OUTPUT MULTIPLEMER OTY-1 SCHEMATIC ED 87305	MODE: DATA ERRATIC FROM DBC TO MCIU.  CAUSE(S): (1) FAILURE OF THE INVERTER METWORK. (2) FAILURE OF THE SELECTOR CIRCUIT. (3) FAILURE OF PARALLEL/ SERIAL CONVERTER.	DATA ERRATIC FROM DAC TO MCIU. EFFECTS VARY DEPENDING UPON WHICH WORD/BIT FAILS. IF IN EE AUTO MODE, POSSIBLE PREMATURE RELEASE. COULD DROP IN OR OUT OF RATE HOLD. MAY NOT BE ABLE TO STOP AUTO SEQUENCE WITH STOP SWITCH. MAY HOT LIMP IN E/E MANUAL MODE, MAY NOT BE ABLE TO CANCEL NCIU SAFING. GPC MAY DROP INTO JOLE. EE COMMAND MAY FAIL ON. EE MAY BE COMMAND MAY FAIL ON. EE MAY BE COMMAND FAIL ON. CR POSSIBLE LOSS OF EE AUTO COMMANDS AND LOSS OF LIMPING DURING CAPTURE. WORST CASE	OPERATIONAL EFFECIS  ARM MAY STOP USING THE SIDP SWITCH DURING AN AUTO SEQ. THE SEQUENCE MAY STILL FOLLOW ITS PREPROGRAMMED PATH UNTIL THE DESIRED ENDPOINT IS REACHED. STOP SWITCH IS DESIGNED TO INTERRIPT AUTO SEQUENCE. FOR UNEMPECTED MOTION, BRAKES SHOULD BE USED TO STOP ARM.  OR ARM WILL NOT LIMP DURING CAP/RIG SEQUENCE. ARM JOINTS WILL HOT COMFORM TO PAYLOAD DURING A CAPTURE SEQUENCE. IF THERE IS ANY MISALIGNMENU MITN THE GRAPPLE FIXTURE, THE PAYLOAD WILL CHANGE ITS ATTITUDE DURING A FREE FLYING CAPTURE, OR THE ARM MILL BE PRELOADED IF THE PAYLOAD IS BERTHED. IT HAY TAKE LONGER TO COMPLETE A CAPTURE SEQUENCE.  OR ARM COLLD BEGIN TO OPERATE WITH (OR CANNOT CANCEL) RATE HOLD AT ANY TIME WHILE COMMANDING IN A MANUAL AUGMENTED MODE. THE OPERATOR WILL DETECT AND INHERENTLY COMPENSATE.  CREW ACTION  APPLY BRAKES INSTEAD OF THE PROCEED/STOP SWITCH TO STOP. THE ARM.  OR HOME FOR FREE FLYING CAPTURES. ENTER TEST MODE TO LIMP ARM AFTER COMPLETION OF A BERTHED PAYLOAD CAPTURE.  OR APPLY BRAKES TO STOP ARM AND CANCEL THE RATE HOLD FUNCTION.  CREW TRAINING  THE CREW WILL BE TRAINED TO COMMANDS. IF IT ISN'T, APPLY BRAKES.  CREW SHOULD BE TRAINED TO COMMANDS. IF IT ISN'T, APPLY BRAKES.  CREW SHOULD BE TRAINED TO COMMANDS. IF IT ISN'T, APPLY BRAKES.  CREW SHOULD BE TRAINED TO COMMANDS. IF IT ISN'T, APPLY BRAKES.  CREW SHOULD BE TRAINED TO COMMANDS. IF IT ISN'T, APPLY BRAKES.  CREW SHOULD BE TRAINED TO COMMANDS. IF IT ISN'T, APPLY BRAKES.  CREW SHOULD BE TRAINED TO COMMANDS. IF IT ISN'T, APPLY BRAKES.  CREW SHOULD BE TRAINED TO COMMANDS. IF IT ISN'T, APPLY BRAKES.  CREW SHOULD BE TRAINED TO COMMANDS. IF IT ISN'T, APPLY BRAKES.  OR THE ARM TO CAPTURE OF PAYLOAD TO KEEP PRELOAD ON ARM TO A  MINIMAM.  MISSION CONSTRAINT  CREW SHOULD NOT ENTER ANY AUTO MODE UNLESS THEY KNOW EXACTLY WHAT TRAJECTORY THE ARM WILL TAKE AND BUSHES THAT THERE ARE NO  OBSTACLES IN THE PAYLOR OF THE STOVEN.  OPERATOR MIST BE ABLE TO DETECT THAT THE ARM IS RESPONDING PROPERTY TO COMMANDS VIA WINDOW AND/OR CCTV VIEWS DURING ALL  ARM OPERATOR WIST BE ABLE

## CRITICAL ITEMS LIST

PROJECT: SAMS SYSTEM: D&C SUBSYSTEM ASS'Y P/N: 5114DE391 ASS'Y NOMENCLATURE: DAC PANEL SHEET: \_\_\_7 NAME, OTY, & DRAWING REF. FHEA FHEA FAILURE HODE FAILURE EFFECT HDWR / FUNC. RATIONALE FOR ACCEPTANCE REF. REV. AND **DESIGNATION** CAUSE END ITEM CRITICALITY SCREENS: N/A 1071 OUTPUT 1 MODE: DATA ERRATIC MULTEPLEXER DATA ERRATIC FROM D&C TO OMRSD ONLINE INSTALLATION OTY-1 FROM D&C TO MCIU. EFFECTS SCHEMATIC MC1U. VARY DEPENDING ED 87305 UPON WHICH NONE CAUSE(S): WORD/BIT FAILS. IF IN EE AUTO MODE, POSSIBLE PREMATURE (1) FAILURE OF THE OMRSD ONLINE TURNAROUND INVERTER NETWORK. RELEASE. COULD DROP IN OR OUT OF RATE HOLD. EXERCISE ALL DEC PANEL SWITCHES AND DISPLAYS (2) FAILURE VERIFY CORRECT RESPONSE OF THE MAY NOT BE ABLE TO STOP AUTO SEQUENCE WITH SELECTOR CIRCUIT. STOP SWITCH. (3) FAILURE OF PARALLEL/ MAY NOT LIMP IN E/E MANUAL SERIAL HODE. MAY NOT CONVERTER. BE ABLE TO CANCEL MCIU SAFING. GPC HAY DROP INTO IDLE. EE COMMAND MAY FAIL ON. EE MAY BE COMMANDED AS SOON AS EE MODE SWITCH SET TO AUTO. POSSIBLE LOSS OF EE AUTO LOSS OF LIMPING DURING CAPTURE. WORST CASE UNEXPECTED HOTTON. 6 JOINT AUNAWAY. UNCOMMANDED END EFFECTOR RELEASE. UNANNUNCIATED. CREW ACTION REQUIRED. REDUNDANT PATHS REMAINING H/A SUPERCEDING DATE: 06 OCT 87 APPROVED BY: PREPARED BY: MFWG DATE: 24 JUL 91

RMS/D&C - 202

CIL REV: 1